


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established by Samuel W. Lackland, deputy surveyor, under G.L.O. contract No. 384 dated March 29, 1881. Surveyor general's record states: South 89° 44' East on true line between Sections 6 and 7.

40.14 Set stone 14"x6"x6" in mound of stone for 1/4 section corner.

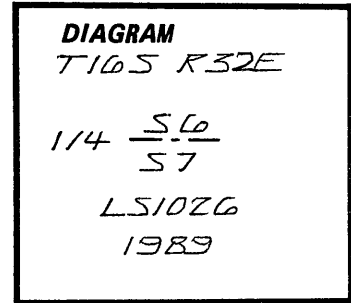

E - 3
F.B. 9 P. 20,21

Description of corner evidence found:

At assumed corner location found basalt stone 14"x5"x5" firmly set 12" in ground marked "1/4 S" on North face. Stone set in stone collar of 4 other stones. East-West wire fence passes 1 ft. South.

Description of monument and accessories | established to perpetuate the original location of this corner:

At position of found marked stone set a 2-1/2" O.D.x30" long aluminum pipe 24" in ground with a 2-1/2" diameter aluminum cap marked as shown: Deposited original stone East of cap and raised 3 ft. diameter stone mound to cap.


Bearing Trees Marked:

A 14" Ponderosa Pine bears South 18° West, 27.1 ft., scribed "1/4 S7BT"; a 14" Ponderosa Pine bears North 49-1/2° West, 14.8 ft., scribed "1/4S6BT". Painted a 6" red band and face blazes red. Nailed signs 54-9 and 54-3 to BT's. Nailed a brass washer stamped "LS1026" to face blazes of BT's. Set a steel post 5 ft. West of cap with signs 54-2 and 54-9. Bearings are by staff compass and declination is 19-1/2° East.


I hereby certify that the above corner monument was re-established as herein described on November 9, 1989.

Witnesses: Wes G. Heigh
Paul D. Woodworth

See C.S. #1124

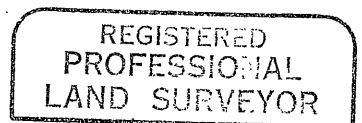

David B. Armstrong



Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 13 day of Feb, 1990
Robert D. Begett by _____
(COUNTY OFFICIAL) (DEPUTY)