

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

The original corner was established in 1884 by Henry W. Cooke under Contract No. 494. The original notes state:

"Set a basalt stone 18x16x10 ins 12 ins in ground for 1/4 sec cor marked 1/4 on N. face and raised a mound of stone alongside.

DIAGRAM

T16S R33½E
S24
1/4 ———
S25

Description of corner evidence found:

Found no evidence of the original monument or accessories.

Description of monument and accessories | established to perpetuate the original location of this corner:

Re-established this corner by single proportion. Set a 3¼" x 30" aluminum monument 22" in the ground in a mound of stone, in a N/S fenceline.

T16S R33½E
S24
1/4 ———
S25
PLS 1918
1985

Marked a 10" Ponderosa Pine N58½°E, 225.7 ft, scribed 1/4S24BT, with a 3/4" brass washer marked "LS 1918".

Marked a 9" Ponderosa Pine S11-3/4°E, 219.5 ft, scribed 1/4S25BT, with a 3/4" brass washer marked "LS 1918".

Painted faces and bands red and attached appropriate USFS signs to BTs.

Set a steel fence post North 3 ft. with Attention sign.


Basis of Bearings - solar observation.

Work performed 6/16/85.

Witnesses: Louise H. Parsons, Douglas T. Parsons.

Road Cadastral Survey for the USDA, Forest Service.

Tyler B. Parsons
Professional Land Surveyor
1915 S.E. Stone St.
Corvallis, OR 97333
(503) 752-7515

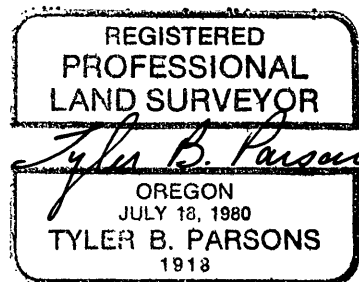

Office of.....*Surveyor*..... County of.....*Grant*.....
State of.....*Oregon*..... I hereby certify that the within instrument was filed in this office
for record on the.....*22* day of.....*Aug*....., 19.....*85*.....
.....*Robert D. Dayett*..... by.....
(COUNTY OFFICIAL) (DEPUTY)