


CORNER RESTORATION

CORNER: ¼ Corner common to Sections 9 and 10
Township 17 South, Range 27 East,
Willamette Meridian

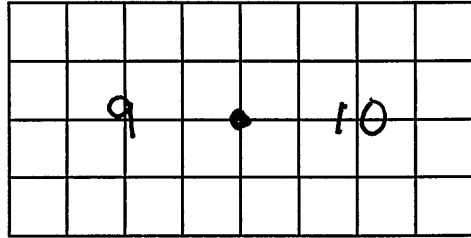

ORIGINAL SURVEY BY: Henry W. Cooke


CONTRACT NUMBER: 427

CONTRACT DATE: June 24, 1882

ORIGINAL DESCRIPTION: Set a basalt stone 18x14x8 inches, 16 inches in ground for ¼ Section corner marked ¼ on West face; raised a stone mound alongside.

RESTORATION BY, STAMP AND DATE:

John G. Lawson
Mike Weisenborn

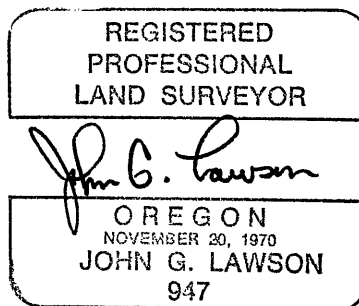


December, 1999

EVIDENCE FOUND: Izee County Road Plans in 1958 show finding a mound of rock at this locaiton. We tied in existing road and replace the corner as close as possible to the 1958 position. PI 24+84.46 bears North 85°05'44" West, 926.06 (plat = 927.15), PI 54+77.73 bears South 27°44'14" East, 2,129.69 (plat = 2,132.19). this position fits the begin ascent call to the North and the river call to the South. The mound of rock appears to have been obliterated by the 1964 storm. We accepted this as the best possible position for this corner. There is no record left of County or State field notes on this road.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

At the corner point, I set a 1" x 24" galvanized iron pipe, with a Brass Cap stamped as shown, 24" in the ground.

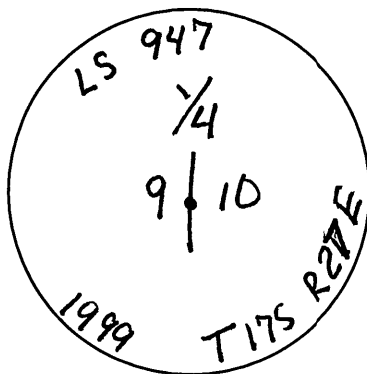

RECEIVED AND
FILED

APRIL 27, 2000
OFFICE OF COUNTY SURVEYOR
Attest: Paul S. Gault

From which:

18" Juniper bears North 23° West, 35.73 feet with aluminum nail with washer
16" Juniper bears North 43° East, 40.01 feet with aluminum nail with washer
16" Juniper bears South 36° East, 88.67 feet with aluminum nail with washer
5/8" Iron rod bears South 46°58' East 198.98 feet

compass with 20° East variation, and measured to the nail in the face of the tree.