


CORNER RESTORATION

CORNER: One-quarter corner common to Sections 22 and 23
Township 17 South, Range 27 East,
Willamette Meridian

ORIGINAL SURVEY BY: Henry W. Cooke

CONTRACT NUMBER: 427

CONTRACT DATE: Dec. 15, 1881

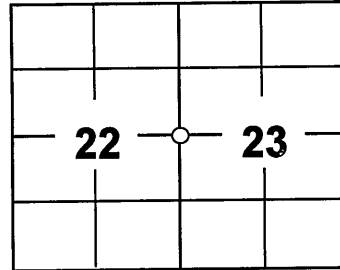


ORIGINAL DESCRIPTION: Set a basalt stone 14x12x10 inches, 10 inches in the ground for one-quarter Section corner marked 1/4 West face and a raised mound of stone along side.

RESTORATION BY, STAMP AND DATE:

John G. Lawson

Date: August, 2007

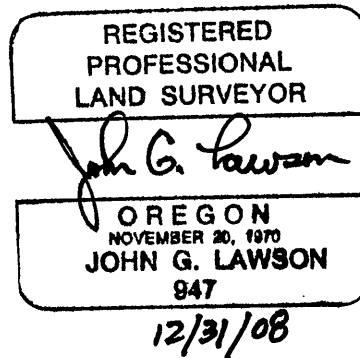


EVIDENCE FOUND:

Found stone 12x10x8, marked 1/4

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

At the corner point, I set a 1"x24" galvanized iron pipe with a brass cap as shown; 18 inches in the ground with a mound of stone.

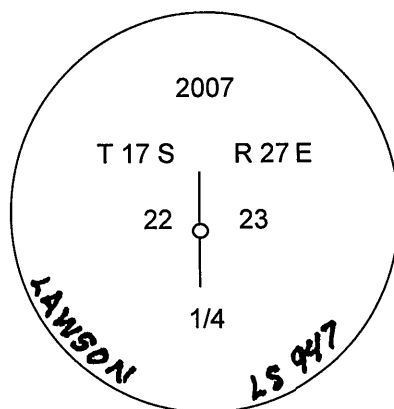

From which:

8 inch diameter Juniper bears North 25 West, 11.33 feet, scribed 1/4 S, 22 BT.

10 inch diameter Juniper bears North 80 East, 17.7 feet, scribed 1/4 S, 23 BT.

6 inch diameter Juniper bears South 42 East, 13.3 feet, 1/4 S, 23 BT.

9 inch diameter Juniper bears South 17 West, 15.57 feet, scribed 1/4 S, 22 BT.

Variation 19°

RECEIVED AND
FILED

DEC. 11, 2007
OFFICE OF COUNTY SURVEYOR
Attest: *[Signature]*