


CORNER RESTORATION

CORNER: One-quarter corner common to Sections 21 and 28,
Township 17 South, Range 27 East,
Willamette Meridian

ORIGINAL SURVEY BY: Henry W. Cooke

CONTRACT NUMBER: 427

CONTRACT DATE: December 15, 1881

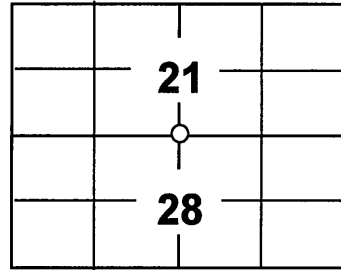


ORIGINAL DESCRIPTION: Set a basalt stone 12x12x6 inches, 8 inches in the ground for one-quarter corner marked 1/4 on North face from which a Juniper, 16 inches diameter, bears North 35 East, 147 links distance, marked one-quarter BT. No other trees within limits and raised a mound of stone alongside.

RESTORATION BY, STAMP AND DATE:

John G. Lawson

August, 2007

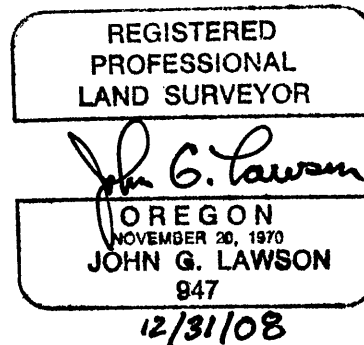


EVIDENCE FOUND:

Found original bearing tree-an 18 inch diameter burned out snag with broken top and burned hollow where the original face would have been. Found stone marked one-quarter in ring of stones, South 35 West, 97.75 feet.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

At the corner point, I set a 1x24 inch galvanized iron pipe with a brass cap as shown, 18 inches in the ground with mound of stone.

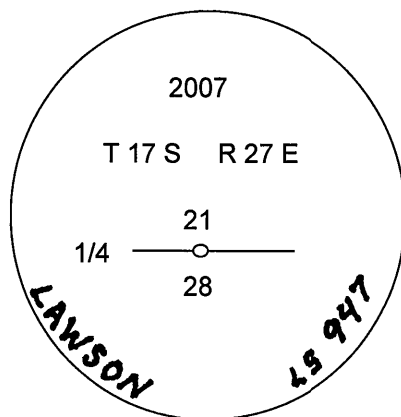

From which:

8 inch Juniper North 67 East, 9.45 feet scribed 1/4 S 21 BT.
10 inch Juniper South 02 West, 6.5 feet scribed 1/4 S 28 BT.
14 inch Juniper South 53 West, 22.15 feet scribed 1/4 S 28 BT.
6 inch Juniper North 01 West, 37.65 feet scribed 1/4 S 21 BT.

Variation 19°

RECEIVED AND
FILED

DEC. 11, 2007
OFFICE OF COUNTY SURVEYOR
Attest: *[Signature]*