


CORNER RESTORATION

S1/4 Corner
CORNER Sec.34 TWP 17 S. RANGE 27 E.

ORIGINAL SURVEY BY: Alonzo Gesner

CONTRACT NUMBER: 206



CONTRACT DATE: July 10, 1874

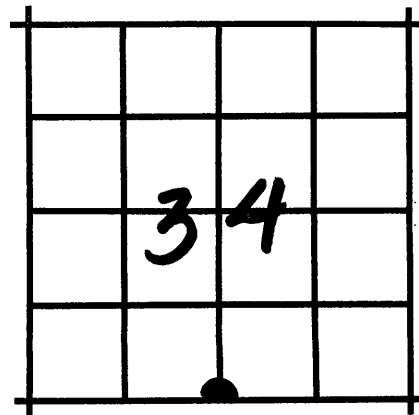

ORIGINAL DESCRIPTION: Set stone 8"x 8"x8", for 1/4 sec cor.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
D.I. Griffith
Jeff Petersen

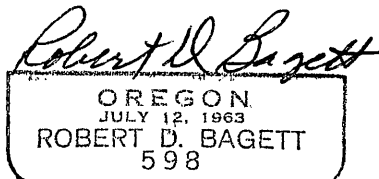

June 11, 1990

Grant County Surveyor

EVIDENCE FOUND: Found a stone 10"x 8"x 8" marked 1/4, faint.

RECEIVED AND
FILED

JUL 17 1990

OFFICE OF COUNTY SURVEYOR
Attest: *[Signature]*


See Survey No. 1149, dated June, 1990.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

In place of stone: I set a 1½"x30" galv. iron pipe, 14" in the ground, with attached brass cap marked as shown. From which;
A 5/8" x 18" rebar with aluminum cap marked "GRANT COUNTY SURVEYOR RP1 " bears N51°E, 7.69 feet.
A 5/8" x 18" rebar with aluminum cap marked "GRANT COUNTY SURVEYOR RP2 " bears S34°E, 7.22 feet.
A Juniper 13" diam bears S46°W, 152.6 feet, marked X BT.
A Juniper 11" diam bears N17°W, 15.40 feet, marked 1/4 S 34 BT.
I buried the stone East and alongside the monument.
Raised mound of stone around the monument.

MONUMENT MARKED

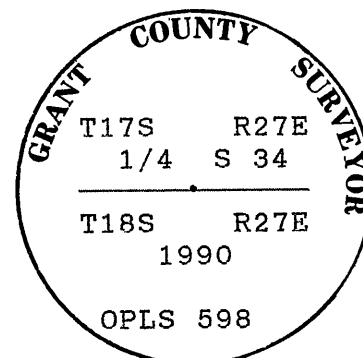

I used a magnetic compass with 18°E var. and steel tape, in the establishment of new accessories. The distances are to a 50d spike driven into the right side at the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.