

RECORD OF LAND CORNER MONUMENTATION

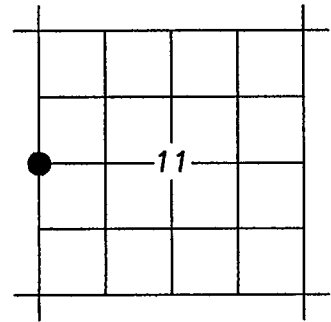
CORNER: W $\frac{1}{4}$ Cor. Sec. 11, T.17S., R.31E., W.M.

ORIGINAL SURVEY BY: Samuel L. Lackland

CONTRACT NUMBER: 197

CONTRACT DATE: May 29, 1881

SUBSEQUENT SURVEY: Scott R. McIntyre 1979



ORIGINAL G.L.O. DESCRIPTION: Set stone 20x12x8 in mound of stone for $\frac{1}{4}$ sec. cor. from which: a pine 20 in. dia. bears N.3°W., 10 lks. dist.

1979 RESURVEY BY SCOTT R. MCINTYRE, CADASTRAL SURVEYOR UNDER SPECIAL INSTRUCTIONS DATED 05/21/1979 (Pg. 374): SEE RECORD MAP OF SURVEY NO. 752.

The $\frac{1}{4}$ sec. cor. of secs. 10 and 11, monumented with an embedded mound of stone, 2 ft. base, 6 ins. high, from which the remains of an original bearing tree:

A pine stump, 18 ins. diam., bears N. 3° W., 10 lks. dist., with burned blaze, no marks visible.

At the corner point

Set an iron post, 28 ins. long, 2 $\frac{1}{2}$ ins. diam., 23 ins. in the ground, in a collar of stone, with brass cap mkd.

T 17 S R 31 E
S 10 $\frac{1}{4}$ S 11
1979

from which new bearing trees

A fir, 9 ins. diam., bears N. 69° E., 44 lks. dist., mkd. $\frac{1}{4}$ S11 BT.

A fir, 12 ins. diam., bears S. 80° W., 88 lks. dist., mkd. $\frac{1}{4}$ S10 BT.

Corner is located at bottom of descent, slopes W.

EVIDENCE FOUND:

None. No field visit was made for this Corner Restoration Report, it has been prepared from record General Land Office and Bureau of Land Management field notes. See Record Map of Survey 752 filed in the Grant County Surveyor's Office.

PREPARED BY:


Michael C. Springer, PLS
Grant County Surveyor
Marcus Teague, Technician

217 N. Canyon Blvd.
John Day, OR, 97845
(541) 575-1251


December 21, 2016

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

DEC 27 2016

BY: 

REGISTERED
PROFESSIONAL
LAND SURVEYOR


OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2018