

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


(67)
VI-1

History of original corner establishment:

Corner established in 1884 by Henry W. Cooke under General Land Office contract #494

Surveyor General record states;

Set post and marked stone for 1/4 sec. cor. dug pits and raised mound of earth 1 1/2 ft. high and 3 1/2 ft. base around post.

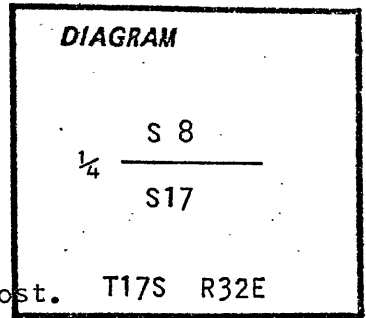

No record of subsequent remonumentation was found in the County records

Description of corner evidence found:

Area falls in a meadow-- I probed for stone, did not find it


See map of survey dated October 1981

Description of monument and accessories I established to perpetuate the original location of this corner:

At proportionate distance I set a 2 1/2 x 30 inch aluminum pipe with aluminum cap marked as shown 28 inches in the ground from which;

A 1" X72" steel fence post driven 24 inches in the ground bears North 4.7 feet

A 1" x72" steel fence post driven 24 inches in the ground bears West 4.8 feet

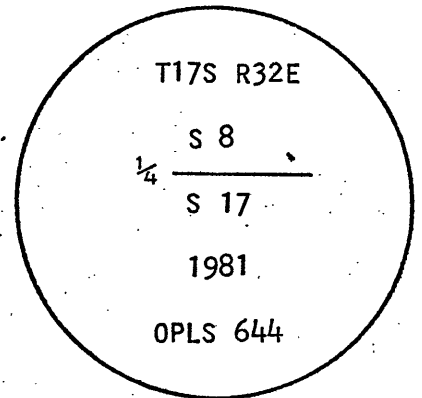

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Degett
OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

Date. October 8, 1981

Brass washer nailed to BT blaze. Used steel tape and magnetic compass with 21° East declination in the establishment of accessories. Original BTs measured to face of blaze. New BTs measured to center of tree.

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office for record on the 23 day of Dec, 1981
Robert D. Degett by _____
(COUNTY OFFICIAL) (DEPUTY)