

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


68

History of original corner establishment:

Corner established in 1884 by Henry W. Cooke under General Land Office contract #494

Surveyor General record states;

Set post with marked stone for 1/4 sec.cor. dug pits and raised mound of earth 1 1/2 ft. high 3 1/2 ft. at the base around post

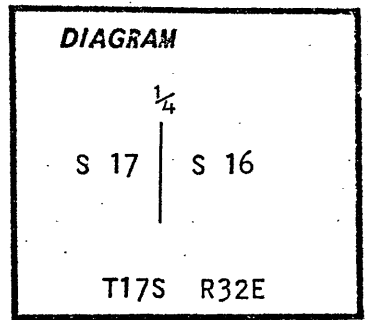

No record of subsequent remonumentation was found in the County records

Description of corner evidence found:

Area is in a meadow--I probed for marked stone and dug in area of the remains of an old fence corner.

No evidence found

See map of survey dated October 1981

Description of monument and accessories I established to perpetuate the original location of this corner:


At propoportionate distance I set a 2 1/2 x 30 inch aluminum pipe with aluminum cap marked as shown 30 inches in the ground from which;

A 1" x 72" steel fence post, driven 24 inches in the ground, bears North 6.9 feet

A 1" x 72" steel fence post, driven 24 inches in the ground, bears West 5.1 feet

The remains of an old fence corner lays 4 feet South and 3 feet West of monument.

Antelope Creek lays North 30 feet and East 16 feet

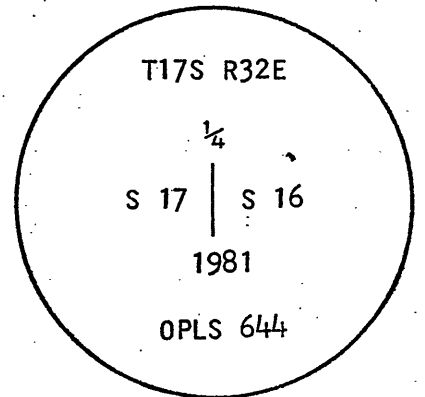

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

Robert D. Baggett

OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

Date, October 1, 1981.

Brass washer nailed to BT blaze. Used steel tape and magnetic compass with 21° East declination in the establishment of accessories. Original BTs measured to face of blaze. New BTs measured to center of tree.

Office of *Surveyor* County of *Grant*

State of *Oregon* I hereby certify that the within instrument was filed in this office

for record on the *23* day of *Dec*, 19*81*

Robert D. Baggett by _____

(COUNTY OFFICIAL)

(DEPUTY)

L-9