


6

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

The original corner was established in 1884 by Henry W. Cooke.

Set a basalt stone 16x12x10 ins. 10" in the ground for 1/4 sec cor. marked 1/4 on W. face and raised a mound of stone 1 1/2 ft high and 3 1/2 ft base alongside.

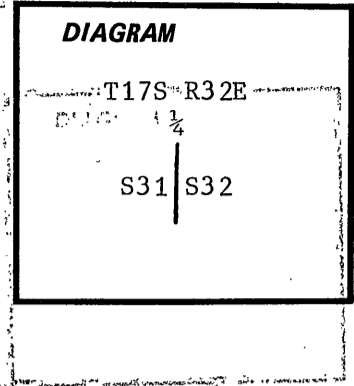

Description of corner evidence found:

Found no evidence of the original stone or the stone mound after dilligent search. The corner location falls near an irrigation ditch and may have been destroyed during construction of the ditch. The length of the section line passing through this corner is approximately 1 chain long. Search was conducted to cover areas 40 chains and 41 chains North of the section corner to the South. The corner is considered to be lost.

Description of monument and accessories | established to perpetuate the original location of this corner:

Reset this corner by single proportion. Set a 3 1/4" x 30" aluminum CAP MARKED monument 22" in the ground.

A 2" aluminum cap on rebar bears West 25.0 feet stamped T17S R32E 1/4 S31 RM EAST 25.0 PLS 1918 1985.

A 2" aluminum cap on rebar bears East 25.0 feet stamped T17S R32E 1/4 S32 RM WEST 25.0 PLS 1918 1985.

T17S R32E
1/4
S31 | S32
PLS 1918
1985

Set a steel fence post and Attention sign North 3 feet.

Work performed 19 May 1985
Witness: Louise H. Parsons

Tyler B. Parsons, PLS 1918
1915 SE Stone Street
Corvallis, OR 97333
(503) 752-7515

Road Cadastral Survey, Cont No 53-04H1-4-9665N



Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 19 day of June, 1985
Robert D. Baggett by _____
(COUNTY OFFICIAL) (DEPUTY)