CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established by Barnford Robb under joint contrat of Robb & Eckelson number 366, dated August 18, 1880. Surveyor General's records state :-

Set basalt stone 12x8x6 for 1/4 sec cor from which

A pine 36 ins diam bears S. 10° E. 62 lks distant
A pine 24 ins diam bears N. 30° W. 45 lks distant

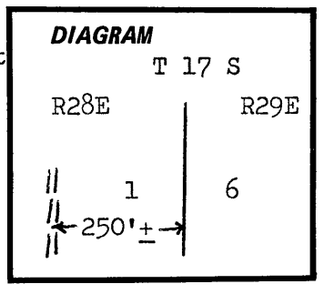

Description of corner evidence found:

I found a lone rock 12x8x6 marked 1/4 on the south face with a wooden hub alongside.

No evidence of original BT's except a stump hole S. 10° E 45'± distant with old rotted stump and old logs nearby. A rotted tree lies South with stump location in middle of skid trail, N. 30° W. approximately 30' distant.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the location of the marked rock I set a standard F. S. Aluminum monument consisting of a 3" disk mounted on a 2x30" pipe with a 4x4½" footplate, buried 24" deep with 6" protruding above the ground. The original marked rock is buried alongside. The disk is stamped as shown

A 9" pine bears N. 45° E. a distance of 7.0 feet scribed 1/4S1 BT
a 12" Pine bears N. 73°30' W. a distance of 5.9 feet, scribed 1/4 S 1 BT

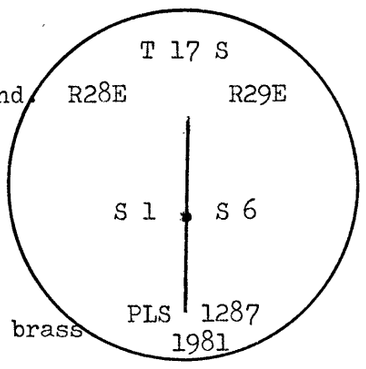

Both banded with red paint, have BT and Attention signs and have a brass disk stamped PLS 1287 nailed at the base of the BT blaze.

Monument set 10/20/81

Witnesses: H.W. Palmer
P. Zabala

Monument set as part of U.S. Forest Service "Three Piece" cadastral survey, see Survey Plat dated Nov. 1981, Grant County Survey No. 708.

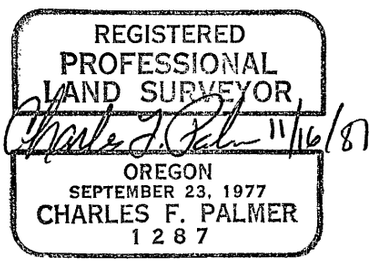

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 18 day of Dec, 1981
Robert D. Nugent by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

☆GPO—798-276

Supersedes remon Sheet filed 3-23-82