

RECEIVED AND
FILE

JUL 28 1975
John Liveira
JOHN LIVEIRA, County Clerk

CORNER RESTORATION


By _____ Deputy

SW Corner
CORNER Sec. 36 TWP 18 S., RANGE 26 E.

ORIGINAL SURVEY BY: Alonzo Gesner

CONTRACT NUMBER: 206

CONTRACT DATE: July 10, 187

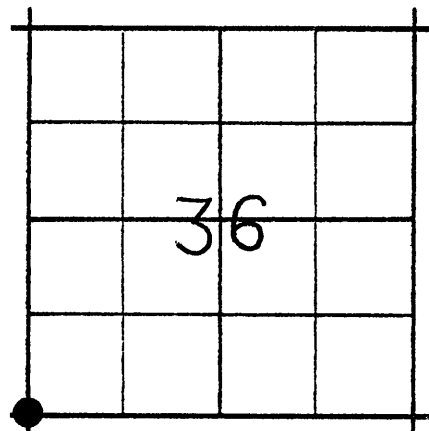

ORIGINAL DESCRIPTION:

80.00 Set stone 16x12x4 for corner to Secs. 35, 36, 1 and 2
from which
A Pine 24" dia bears N. 45° E. 23 links

RESTORATION BY, STAMP AND DATE:

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Baggett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

June 16, 1975

Grant County Surveyor

EVIDENCE FOUND:

I found a stone 17x12x5 ins. marked with 5 grooves on West side and 1 groove on East loosely set in a mound of stone and the original bearing tree. This corner is located 3 ft. Southwest from a fence corner of fences running East and North.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

I set an Iron pipe 1½" in diameter 30" long 26" in ground with brass cap as shown from which ORIGINAL BEARING TREES:

A 32" pine in good shape bears N. 45° E. 15.2 ft. with partial scribing visible

MONUMENT MARKED

NEW BEARING TREES:

A 26" Pine bears S. 32° E. 47.5 ft. marked T19S R26E S 1 BT

A 42" Pine bears S. 11° W. 51.5 ft. marked T19S R26E S 2 BT

A 7" Pine bears N. 85° W. 33.5 ft. marked T18S R26E S35 BT

I buried the original stone west and alongside of the pipe. Used compass with 20° E. Var. and steel tape, measuring to face of BT blaze.

Complete and File with Office of the Grant
County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

