


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner not previously established.

DIAGRAM

T18S R27E K-18

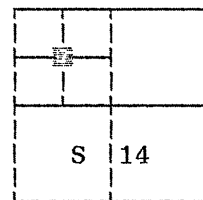

No record of subsequent monumentation found in Grant County survey records.

Description of corner evidence found:

Corner not previously established.

See map of survey 1149 dated June, 1990.

Description of monument and accessories I established to perpetuate the

original location of this corner: At position determined by survey, I set a 2½" x 30" aluminum pipe with aluminum cap marked as shown, 24 inches in the ground, from which:

New BTs, and, or BOs:

A 2'x 3'x 18" high rock outcrop bears S 4°E, 16.15 feet, marked X BO on the East face 12" above the ground.

A 3'x 4'x 3' high rock outcrop bears S47°W, 28.95 feet, marked X BO on the SE face 18" above the ground.




Raised mound of stone 4' base to top of cap.

Set a steel fencepost approximately 5 feet South with land survey monument sign attached.

I hereby certify that the above corner point was perpetuated as hereon described on June 12, 1990.

Witnesses:

Larry Pitcher

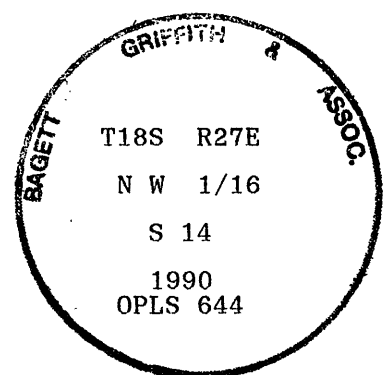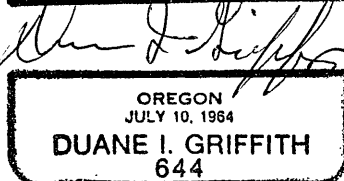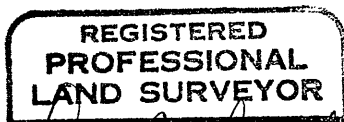

I used a steel tape and magnetic compass in the establishment of new accessories. I used 18° East magnetic declination and the distances are to a 50d spike driven into the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of... Surveyor ... County of... Grant ...
State of... Oregon ... I hereby certify that the within instrument was filed in this office
for record on the... 17 day of... July ... 19... 90 ...
... Robert D. Baggett ... by ...
(COUNTY OFFICIAL) (DEPUTY)