


CORNER RESTORATION

E 1/4 COR
CORNER Sec. 19 TWP 18 S. RANGE 28 E

ORIGINAL SURVEY BY: Henry W. Cooke

CONTRACT NUMBER: 494

CONTRACT DATE: January 16, 1884

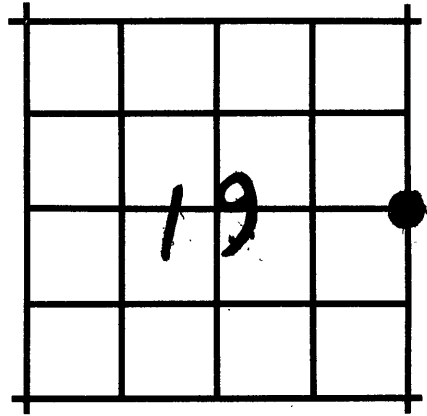

ORIGINAL DESCRIPTION: Set stone 20"x12"x8", 15 ins in ground for 1/4 section corner, marked 1/4 on W face and raised a mound of stone alongside.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
D.I. Griffith

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1983
ROBERT D. BAGETT
598

June 11, 1990

Grant County Surveyor

EVIDENCE FOUND: Found a stone 20"x11"x8" firmly set in a mound of stones, marked 1/4 on the W face.

RECEIVED AND
FILED

JUL 17 1990

OFFICE OF COUNTY SURVEYOR
Attest: *[Signature]*

See Survey No. 1149, dated June, 1990.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

In place of stone: I set a 1½"x30" galv. iron pipe, 20" in the ground, with attached brass cap marked as shown.

From which;

A Juniper 18" diam bears N80°E, 34.89 feet, marked 1/4 S 20 BT

A Juniper 8" diam bears S20°E, 26.23 feet, marked X BT

A double bole Juniper 11" diam. bears S16°W, 22.78 marked XX BT

A Juniper 14" diam bears N70°W, 18.10 feet. marked 1/4 S 19 BT

I buried the marked stone South and alongside the iron pipe and raised a mound of stone to top of cap.

Used mag. compass with 18°E var. and a steel tape, in the establishment of new accessories. The distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

MONUMENT MARKED

