


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Henry W. Cooke under General Land Office Contract No. 494 dated January 16, 1884.

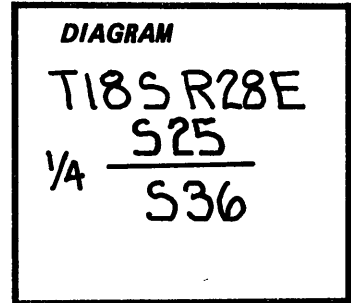

Surveyor General's records state:

Va 20°E

S88°23'W on a true line between Secs 25 & 36 with same Va descend 600 ft to

18.15 Brook 30 lks wide runs N20°W Ascend 600 ft.

40.07 Set adbasalt stone 16X12X5 ins 11 ins in

ground for 1/4 sec cor marked 1/4 on N face

From which: a fir 12 ins dia bears N52°E 40 lks dist marked 1/4SBT;

a fir 15 ins dia bears S57°E 45 lks dist marked 1/4SBT. Ascend 300 ft.

56.00 Top of ridge course N & S. Descend 400 ft to cor

80.15 The cor to secs 25, 26, 35 & 36.

F.B.3 P.33 & 34
V-23

Description of corner evidence found:

At assumed corner location found basalt stone 20"X15"X4" firmly set upright in center of mound of stone 2 1/2 foot diameter consisting of approximately 5 other stones. Stone plainly marked "1/4" on North face. Found the original SE bearing tree, a 22" Douglas Fir bears S53°15'E, 29.1 ft. to center of tree. Faces completely healed over, tree in good condition. Found the remains of the original NE bearing tree a 16" dead and down Douglas Fir, the root hole of which bears N53°00'E, 23.5 ft.. The tree has slid downhill (East) 13 ft. from root hole. Visible scribing on tree-1/4 and a portion of the B & T. Accept set marked stone in center of mound as corner.


Description of monument and accessories | established to perpetuate the original location of this corner:

At position of found original stone in center of stone mound, set 2 1/2 inch X 30 inch long aluminum pipe 22 inches in ground with 3 1/4 inch aluminum cap marked as shown:

The original SE bearing tree bears South 53°15' East, 29.1 ft., with healed faces. (22" Douglas Fir)

Marked 1 new bearing tree:

a 15" Juniper bears North 9°30' East, 46.2 ft., scribed-1/4S25BT.

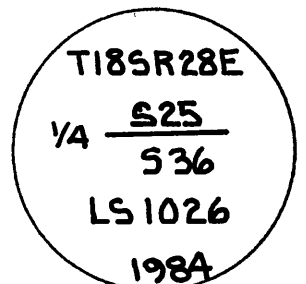


M.V. 18°30'E.

Deposited original stone East of pipe and raised stone mound 2 foot diameter to cap. Painted red band and faces red and nailed signs 54-3 and 54-4 on all bearing trees.

Nailed brass washer stamped-AS&E LS1026-to blaze of new bearing tree. Set 6 foot steel post 5 feet West with sign 54-4 facing corner and sign 54-2. Also set 6 foot steel post 5 feet East with sign 54-2..

I hereby certify the above corner monument was re-established as herein described on July 3, 1984.

Witnesses: Shelby H. Griggs
Daniel Patterson

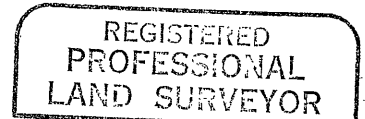

David B. Armstrong

Office of.....*Surveyor*..... County of.....*Grant*.....
State of.....*Oregon*..... I hereby certify that the within instrument was filed in this office
for record on the.....*18*..... day of.....*Jan*....., 19*85*.....
.....*Robert D. Segott*..... by.....
(COUNTY OFFICIAL) (DEPUTY)

