

CERTIFIED RECORD OF LAND CORNER MONUMENTATION**History of original corner establishment:**

The original GLO survey was done by Bamford Robb under contract no. 366, dated August 18, 1880.

DIAGRAM

T 18 S, R 29 E
W M
C 1/4
S 7

Description of corner evidence found:

This corner was not set under the original GLO survey. Nothing found.



Description of monument and accessories established to perpetuate the original location of this corner:

On 11/14/86 at the proportioned location, we set an all alum. monument 2 1/2" dia. x 30" long, with a 3" dia. cap stamped "C 1/4, S 7, T 18 S, R 29 E, WM, PLS 1288, 1986", buried 24", 6" above the ground. Set a steel fence post 3' north with a land survey sign attached.

A 8" w fir bears N 29°15'E, 22.9 feet, scribed "C 1/4, S 7, BT"

A 12" p pine bears N 86°30'W, 44.6 feet, scribed "C 1/4, S 7, BT"

Both BT's have a 6" band of red paint, BT and LS signs and a brass washer stamped "PLS 1288" set at the base.

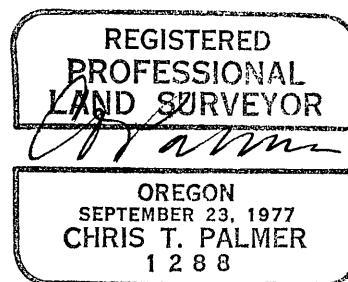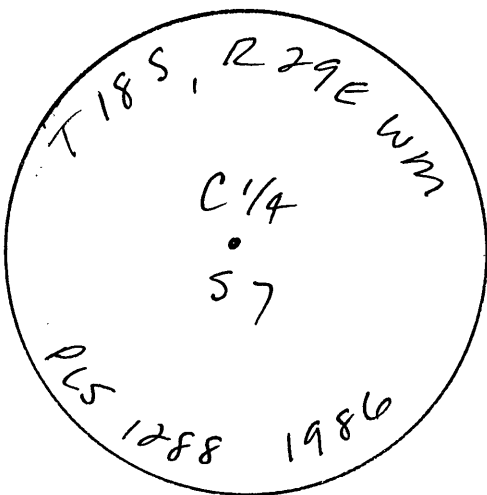

GRANT COUNTY
SURVEY #968

Office of SURVEYOR County of GRANT
State of OREGON, I hereby certify that the within instrument was filed in this office
for record on the 6 day of April, 1987
Robert D. [Signature] by _____
(COUNTY OFFICIAL) (DEPUTY)