


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Bamford Robb under General Land Office Contract No. 366 dated August 18, 1880.

Surveyor General's records state:

N 89°41' E on true line between secs 19 & 30
 37.65 Set stone 18X14X6 in mound of stone for 1/4 sec. cor.
 66.65 Small stream flows N.
 77.65 The cor. to secs 19, 20, 29 & 30.

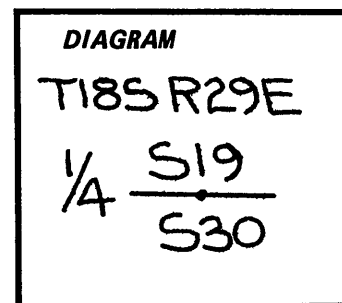

R-3
 F.B.4 Pg.11 & 12

Description of corner evidence found:


At assumed corner location found basaltic stone 18"X14"X6" lying flat on ground with possible tool marks but illegible on top face in solid earth cast. Found three other stones in sunken mound East and North of corner stone. Believe several of the numerous stones scattered about South & East of stone came from around corner stone but were disturbed by persons unknown. Old fence corner Northwest is 4 ft. North and 5 ft. East of corner stone, corner post has old location tag - USFS - noting 1/4 corner location, no name or date, sign faded. Believe stone the original corner monument as it is proper size, near fence corner representing property corner, remnants of stone mound remain, and corner is harmoniously related to section corners, particularly SE corner S.19.

Description of monument and accessories established to perpetuate the original location of this corner:

At position of original stone in stone mound, set 2 1/2 inch O.D. 30 inch long aluminum pipe 14 inches in ground to bedrock with 3 1/4 inch aluminum cap marked as shown:

Marked new bearing trees:

a 10" Ponderosa Pine bears North 53°00' West, 17.7 ft., scribed-1/4S19BT;
 a 10" Ponderosa Pine bears South 6°30' West, 17.0 ft., scribed-1/4S30BT/.


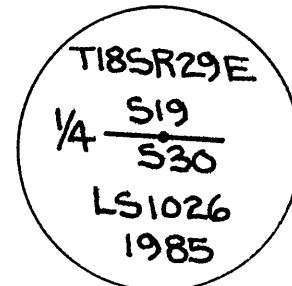


M.V. 19° E.

Deposited original stone South of cap and raised a stone mound 4 foot diameter to cap. Painted red band and face red and nailed signs 54-3 and 54-4 on all bearing trees. Set steel post 5 feet West with sign 54-4 facing corner. Nailed brass washer stamped "AS&E LS1026" to face of new bearing trees.

I hereby certify the above corner monument was re-established as herein described on May 13, 1985.

Witnesses: David B. Armstrong
 Daniel N. Patterson

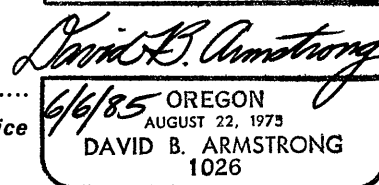

Office of Surveyor County of Grant
 State of Oregon I hereby certify that the within instrument was filed in this office
 for record on the 15 day of July, 1985
Robert D. Baggett by _____
 (COUNTY OFFICIAL) (DEPUTY)