

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner established by Reuben R. Leigh under General Land Office Contract No. 462 dated April 11, 1883.

Surveyor General's records state:

North bet secs 21 & 22 va. 19°E

80.00 Set a basalt stone 20x18x7 ins 15 ins in ground for cor to secs 15, 16, 21 & 22 marked with 3 notches on S. and E. edges Dug pits 18x18x12 ins in each sec 5 1/2 ft dist and raised a mound of earth 2 ft high 4 1/2 ft base alongside.

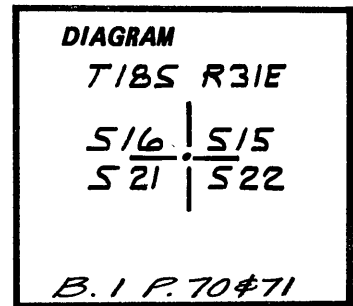

N-13

Description of corner evidence found:

At assumed corner location found basalt stone 20"x18"x7" firmly set 12" in ground at NE cor of rock jack at old angle iron wire fence line. Stone marked with 3 grooves on South & East faces. No evidence found of pits or earth mound. Stone does not appear disturbed and is accepted as the original corner location. 8 foot high woven wire and barbed wire fence passes 6 ft East of and 23 feet North of corner. Old angle iron post and barbed wire fence passes 3 feet West of and 1 foot South of corner.

Description of monument and accessories | established to perpetuate the original location of this corner:

As the evidence in the corner vicinity agrees with the G.L.O. original record, at position of original marked stone, set 30 inch long 2 1/2 inch O.D. aluminum pipe 20 inches in ground to bedrock with 3 1/4 inch aluminum cap marked as shown:

Marked 4 new bearing trees:

A 6" dbh Juniper bears North 44° East, 96.2 ft., scribed "T18SR31ES15BT";
A 22" dbh Juniper bears South 2°30' East, 170.7 ft., scribed "T18SR31ES22BT";
A 7" dbh Juniper bears South 56°45' West, 136.5 ft., scribed "T18SR31ES21BT";
A 16" dbh Juniper bears North 52° West, 63.6 ft., scribed "T18SR31ES16BT".


Nailed brass washer marked "AS&E LS 1026" in lower blaze of new BT's.

Raised a mound of stones and earth 2 1/2 foot base to top of cap and buried the original basalt stone North of cap.

Painted 6 inch red band and faces red and nailed signs 54-3 and 54-4 on all bearing trees. Set steel post with sign 54-4 6 feet South of and facing corner and sign 54-2 also set steel post with sign 54-2 6 feet West of corner.

I hereby certify the above corner monument was re-established as herein described on September 26, 1983.

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 28 day of Dec, 1983
Robert H. Baggett by _____
(COUNTY OFFICIAL) (DEPUTY)

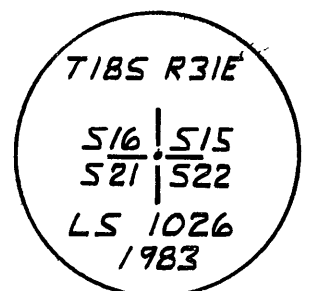

Magnetic
Declination
19°E

