

# RECORD OF LAND CORNER MONUMENTATION


WEST 1/4 CORNER SECTION 4, T. 7 S., R. 28 E., W.M.

**ORIGINALLY ESTABLISHED BY:** Frank W. Campbell, U.S. Deputy Surveyor

**CONTRACT NUMBER:** 521

**CONTRACT DATE:** January 8, 1885

**SUBSEQUENT SURVEYS:** Remonumentation by Duane I. Griffith, PLS, filed August 8, 1974 in the office of the Grant County Surveyor

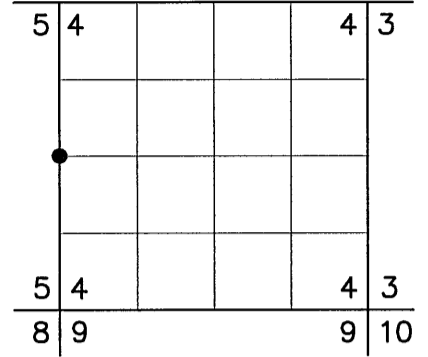

**ORIGINAL DESCRIPTION:** Set a basalt stone 14x10x8 ins 9 ins in the ground, for 1/4 sec cor., marked 1/4 on W. face; from which  
 A pine 10 ins in diam. bears S68°E, 159 lks dist, marked 1/4\$ BT  
 no other trees within limits and raised a mound of stone alongside.

**GRIFFITH'S 1974 DESCRIPTION:** Found stone, call size in a mound of stone marked 1/4, from which:  
 Original B.T.  
 A 22" Pine, in good condition, bears N 71°E, 110.5 ft. Scribes visible. (Blaze faces corner--original bearing probably recorded in wrong quadrant)

At position of original stone, set 2 1/2" x 30" iron pipe, with brass cap marked as shown, 24" in ground. Raised mound of stone 5 ft. at base to top of cap, from which new BTs:  
 A 10" Juniper bears S 31 W, 188.8 ft. marked 1/4 S 5 T 7 S R 28 E BT

**EVIDENCE FOUND:** Found a 2 1/2" galvanized iron pipe with attached 2 1/2" brass cap marked as shown below, firmly set and projecting 4" above ground in a 2 ft. diameter mound of stone. From which, a steel fence post bears South, 5 feet. Also from which, the following bearing trees were found:

- ▶ A juniper 19" dbh bears S.31°W., 188.8 ft. with scribing visible in a partially healed double blaze
- ▶ A ponderosa pine snag, 22" dbh and 15 ft.+/- tall, bears N.71°E., 110.5 ft. with open charred blaze

**DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:**

I accept the found brass capped monument for the true corner position.


From which, **I SCRIBE A NEW BEARING TREE:**

- ▶ A juniper 15" dbh bears N.24°E., 64.1 ft. marked 1/4\$4 in upper blaze and BT in lower blaze

Also from which, **I SET NEW REFERENCE POINTS:**

- ▶ A 5/8"x24" iron pin bears S.44°26'E., 48.07 ft., with attached 2" aluminum cap marked *RP 1 2022 PLS 69454*
- ▶ A 5/8"x24" iron pin bears N.66°52'W., 70.58 ft., with attached 2" aluminum cap marked *RP 2 2022 PLS 69454*

CORNER MONUMENT  
MARKED:

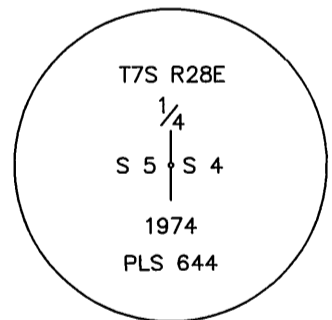

Repaired the mound of stone, and built it back up to the cap. Painted a 6 inch red band around each bearing tree, and also painted the blazes red. Attached USFS 54-3 and 54-9 signs to the bearing trees. Distance to new bearing tree measured with a steel tape, measuring to a 60d nail driven in the right-side-center at the root crown of the tree, with an attached 1 1/2" aluminum washer stamped *PLS 69454*. Used RTK GPS to measure the reference points. Bearings are geodetic, derived by GPS observation at the corner. Attached a new USFS 54-9 sign to the fence post.

**RESTORATION BY, STAMP AND DATE:**

Work Performed May 3, 2022 by:

Jason L. Hatfield, PLS  
 Daniel B. Lee

USDA FOREST SERVICE  
 NORTHEAST OREGON LAND ZONE  
 1550 Dewey Avenue, Suite A  
 Baker City, OR 97814  
 (541) 523-1337

**RECEIVED AND FILED  
 GRANT COUNTY SURVEYOR**

JUN 14 2022

BY: 

**REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR**

  
**OREGON**

NOVEMBER 30, 2007  
**JASON L. HATFIELD  
 #69454**

EXPIRES: 6/30/2023