

# RECORD OF LAND CORNER MONUMENTATION


SOUTH 1/4 CORNER SECTION 4, T. 7 S., R. 28 E., W.M.

**ORIGINALLY ESTABLISHED BY:** Frank W. Campbell, U.S. Deputy Surveyor

**CONTRACT NUMBER:** 521

**CONTRACT DATE:** January 8, 1885

**SUBSEQUENT SURVEYS:** Remonumentation by Duane I. Griffith, PLS, filed August 8, 1974 in the office of the Grant County Surveyor

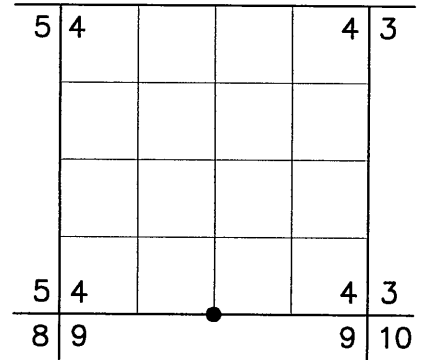

**ORIGINAL DESCRIPTION:** Set a basalt stone 18x9x8 ins 12 ins in the ground, for 1/4 sec cor., marked 1/4 on N. face and raised mound of stone alongside.

**GRIFFITH'S 1974 DESCRIPTION:** Found stone, call size, firmly set in a mound of stone, marked  $\frac{1}{4}$  on the North face. In corner position, set  $2\frac{1}{2}$ " x 30" iron pipe with brass cap marked as shown, 22" in ground, raised mound of stone 7' at base to top of cap, from which new BTs:

- A 7" Juniper bears S 41 E, 86.5 ft. marked  $\frac{1}{4}$  S9 BT
- A 12" Pine bears N 22 W, 59.8 ft. marked  $\frac{1}{4}$  S4 T 7 S, R 28 E, BT

**EVIDENCE FOUND:** Found a  $2\frac{1}{2}$ " galvanized iron pipe with attached  $2\frac{1}{2}$ " brass cap marked as shown below, firmly set and projecting 4" above a 4 ft. diameter mound of stone with steel fence post alongside. From which, the following bearing trees were found:

- ▶ A juniper 12" dbh bears S.41°E., 86.5 ft. with scribing visible in a partially healed double blaze
- ▶ A ponderosa pine 18" dbh bears N.22°W., 59.8 ft. with scribing visible in a healed double blaze


**DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:**

I accept the found brass capped monument for the true corner position.

From which, **I SET NEW REFERENCE POINTS:**

- ▶ A 5/8"x15" iron pin, driven to refusal, bears N.46°29'E., 38.02 ft., with attached 2" aluminum cap marked *RP 1 2022 PLS 69454*
- ▶ A 5/8"x15" iron pin, driven to refusal, bears S.46°44'W., 26.92 ft., with attached 2" aluminum cap marked *RP 2 2022 PLS 69454*

**CORNER MONUMENT MARKED:**

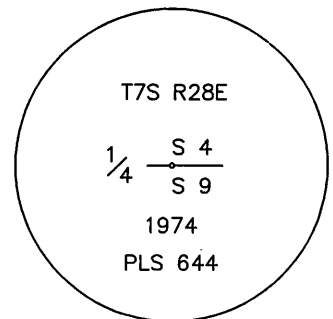

Repaired the mound of stone, and built it back up to top of cap. Painted a 6 inch red band around each bearing tree, and also painted the blazes red. Attached USFS 54-3 and 54-9 signs to the bearing trees. Distances to bearing trees measured with a steel tape to side-center. Bearings to trees measured with a magnetic compass with 14° East declination. Used RTK GPS to measure the reference points. Bearings are geodetic, derived by GPS observation at the corner. Reset steel fence post East of monument and attached a new USFS 54-9 sign.

**RESTORATION BY, STAMP AND DATE:**

Work Performed May 3, 2022 by:

Jason L. Hatfield, PLS  
Daniel B. Lee

USDA FOREST SERVICE  
NORTHEAST OREGON LAND ZONE  
1550 Dewey Avenue, Suite A  
Baker City, OR 97814  
(541) 523-1337

RECEIVED AND FILED  
GRANT COUNTY SURVEYOR

JUN 14 2022  
BY:

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

OREGON  
NOVEMBER 30, 2007  
JASON L. HATFIELD  
#69454

EXPIRES: 6/30/2023