

RECORD OF LAND CORNER MONUMENTATION


SOUTHEAST CORNER SECTION 4, T. 7 S., R. 28 E., W.M.

ORIGINALLY ESTABLISHED BY: Frank W. Campbell, U.S. Deputy Surveyor

CONTRACT NUMBER: 521

CONTRACT DATE: January 8, 1885

SUBSEQUENT SURVEYS: Remonumentation by Duane I. Griffith, PLS, filed August 8, 1974 in the office of the Grant County Surveyor

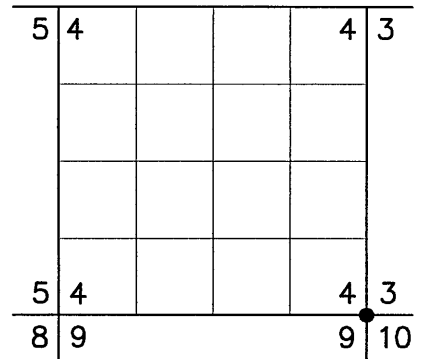

ORIGINAL DESCRIPTION: Set a basalt stone 16x10x7 ins 11 ins in the ground, for cor to Sec's 3, 4, 9 & 10, marked with 5 notches on S. and 3 notches on E. edges. from which
 A pine 14 ins in diam. bears N.40°E., 47 lks. dist. marked T7S R28E S3 BT
 A pine 10 ins in diam. bears S.71°E., 231 lks. dist. marked T7S R28E S10 BT
 A pine 30 ins in diam. bears S.69°W., 79 lks. dist. marked T7S R28E S9 BT
 A pine 10 ins in diam. bears N.63°W., 75 lks. dist. marked T7S R28E S4 BT

GRIFFITH'S 1974 DESCRIPTION: Found stone, call size, properly marked, in mound of stone from which: Original BTs.
 A 18" Pine snag bears N 40 E, 31.0 ft., scribes visible.
 A 15" Pine stump bears S 71 E, 152.5 ft. north scribes or blaze visible.
 A 30" +/- Pine, dead and down, bears S 69 W, 52 +/- ft. scribes visible.
 A 15" +/- Pine, dead and down, badly rotted, bears N 61 W, 49.5 ft., scribes visible.
 At corner position set 2 1/2" x 30" iron pipe with brass cap, marked as shown, 25" in ground, from which: New BTs
 A 15" Pine bears N 35 E, 130.5 ft. marked T 7 S R 28 E S 3 BT
 A 14" Juniper bears S 15 E, 61.5 ft. marked T 7 S R 28 E S 10 BT
 A 16" Pine bears S 42 W, 76.2 ft. marked T 7 S R 28 E S 9 BT
 A 17" Pine bears N 47 W, 89.3 ft. marked T 7 S R 28 E S 4 BT

EVIDENCE FOUND: Found a 2 1/2" galvanized iron pipe with attached 2 1/2" brass cap marked as shown below, projecting 3" above ground in a 2 ft. diameter mound of stone. From which, the following bearing trees were found:

- ▶ A juniper 22" dbh bears S.15°E., 61.5 ft. with completely healed double blaze
- ▶ A charred stump bears S.42°W., 76.2 ft.


No remains of other bearing trees could be found, as the area has been subjected to a wildland fire in the recent past.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
 I accept the found brass capped monument for the true corner position.

CORNER MONUMENT
 MARKED:

From which, **I SET NEW REFERENCE POINTS:**

- ▶ A 5/8"x24" iron pin bears N.58°05'E., 24.56 ft., with attached 2" aluminum cap marked *RP 1 2022 PLS 69454*
- ▶ A 5/8"x24" iron pin bears S.58°02'W., 34.25 ft., with attached 2" aluminum cap marked *RP 2 2022 PLS 69454*
- ▶ A 5/8"x24" iron pin bears N.44°30'W., 17.41 ft., with attached 2" aluminum cap marked *RP 3 2022 PLS 69454*

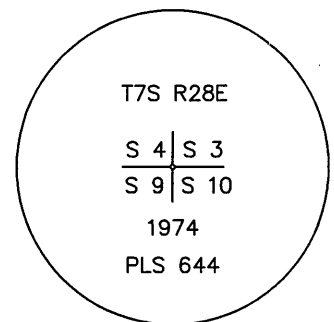

Painted a 6 inch red band around the found juniper bearing tree, and attached USFS 54-3 and 54-9 signs. Distances to bearing trees measured with a steel tape to side-center. Bearings to trees measured with a magnetic compass with 14° East declination. Used RTK GPS to measure the reference points. Bearings are geodetic, derived by GPS observation at the corner. Attached a new USFS 54-9 sign to the fence post set alongside the monument.

RESTORATION BY, STAMP AND DATE:

Work Performed May 4, 2022 by:

Jason L. Hatfield, PLS
 Daniel B. Lee

USDA FOREST SERVICE
 NORTHEAST OREGON LAND ZONE
 1550 Dewey Avenue, Suite A
 Baker City, OR 97814
 (541) 523-1337

RECEIVED AND FILED
 GRANT COUNTY SURVEYOR

JUN 14 2022

BY:

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

OREGON
 NOVEMBER 30, 2007
 JASON L. HATFIELD
 #69454

EXPIRES: 6/30/2023