


# RECORD OF LAND CORNER MONUMENTATION

SOUTHEAST CORNER SECTION 7, T. 7 S., R. 28 E., W.M.

**ORIGINALLY ESTABLISHED BY:** Frank W. Campbell, U.S. Deputy Surveyor

**CONTRACT NUMBER:** 521

**CONTRACT DATE:** January 8, 1885

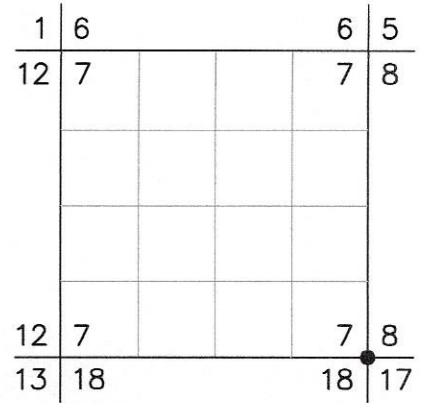

**ORIGINAL DESCRIPTION:** Set a basalt stone 17x10x4 ins 11 ins in the ground for cor to Sec's 7, 8, 17 & 18, marked with 4 notches on S. and 5 notches on E. edges, from which  
 A pine 12 ins in diam. bears N.14°E. 47 lks dist. marked T7S R28E S8 BT  
 A pine 7 ins in diam. bears S.18°E. 148 lks dist. marked T7S R28E S17 BT  
 A pine 7 ins in diam. bears S.15°W. 161 lks dist. marked T7S R28E S18 BT  
 A pine 24 ins in diam. bears N.80°W. 74 lks dist. marked T7S R28E S7 BT

**EVIDENCE FOUND:** Found stone 19"x7"x4" set upright and properly oriented with 4 grooves on the south and 5 grooves on the east, set 11" in the ground in the center of a 2 ft. diameter mound of stone. We searched for any remaining evidence at each of the four record bearing tree locations, but found only root wad depressions in the ground, as the area was subjected to a substantial fire 10 +/- years ago. I accept the position of the found marked stone for the section corner.

**DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:**

At the position of the found stone, I set a standard USFS 2½"x30" aluminum pipe with attached ¾" aluminum cap, 28" in the ground. Raised a 3 ft. diameter mound of stone around the monument to top of cap. Cap is marked as shown below.

From which, **I SCRIBE NEW BEARING TREES:**

- ▶ A western juniper 12" dbh bears N.19°21'E., 32.3 ft. marked T7SR28ES8 in upper blaze and BT in lower blaze
- ▶ A western juniper 13.5" dbh bears N.39°W., 45.1 ft. marked T7SR28ES7 in upper blaze and BT in lower blaze

Also from which, **I SET NEW REFERENCE POINTS:**

- ▶ A 5/8"x 24" iron pin bears S.45°14'E., 10.02 ft., with attached 2" aluminum cap marked RP 1 2022 PLS 69454
- ▶ A 5/8"x 24" iron pin bears S.44°54'W., 14.98 ft., with attached 2" aluminum cap marked RP 2 2022 PLS 69454

CORNER MONUMENT MARKED:



Deposited original marked stone north and alongside the pipe. Placed a plastic-encased magnet at the base of the pipe. Painted a 6 inch red band around each bearing tree, and also painted blazes red. Attached USFS 54-3 and 54-9 signs to BT's. Distances to new bearing trees were measured to a 60d nail driven in the right-side-center at the root crown of the tree, with an attached 1½" aluminum washer stamped PLS 69454. Used RTK GPS to measure accessories. Bearings are geodetic, derived by GPS observation at the corner. Also set an aluminum guard post North, 2.4 ft. from monument, with USFS 54-9 sign attached.

**RESTORATION BY, STAMP AND DATE:**

Work Performed June 8, 2022 by:

Jason L. Hatfield, PLS  
 Daniel B. Lee

USDA FOREST SERVICE  
 NORTHEAST OREGON LAND ZONE  
 1550 Dewey Avenue, Suite A  
 Baker City, OR 97814  
 (541) 523-1283

RECEIVED AND FILED  
 GRANT COUNTY SURVEYOR

FEB 10 2023

BY: 

