


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in October 1884 by William R. Gradon under contract No. 579

Set Stone 14 x 10 x 4 9in. in ground 5 notches S & E

- Pine 10in. diam. brs. N 25° E 195 lks.
- Pine 24in. diam. brs. S 51° E 123 lks.
- Pine 18in. diam. brs. S 53° W 162 lks.
- Pine 24in. diam. brs. N 30° W 95 lks.

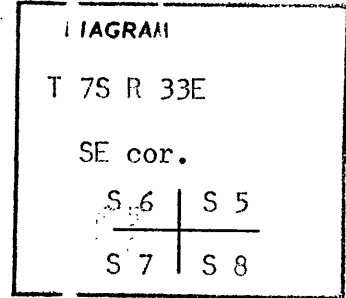

Description of corner evidence found:

- Found pine 30" brs. N 24° E 128.5ft. slope distance. Blaze completely grown over.
- Found pine 30" brs. S 52°30' W 106.5ft. (Blaze has been open on BT)
- Found pine 24" brs. S 51° E 123 lks. (Tree is down the hill from the true location; found possible stump hole at S 51° E 81.3 ft.)

Description of monument and accessories established to perpetuate the original location of this corner

Set 2½" x 30" iron pipe 6 inches in ground. Raised stone mound to within 1 inch of brass cap. Cap is marked as shown from which I scribed two new bearing trees for lost trees:


- A pine 20 in. diam. brs. N 30° W 91.40 ft. marked T 7S R 33E S6 BT
- A pine 16 in. diam. brs. S 30° E 84.60 ft. marked T 7S R 33E S7 BT

Nailed brass washer marked PLS 933 to BT blaze of trees. Set steel post 1 ft. Southwest of corner. Corner is East 900 ft. from road. Used T-2 and steel tape, measuring a horizontal distance to the center of Bearing Trees.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

David H. Kula

OREGON
JULY 17, 1970
DAVID H. KRUMBEIN
933

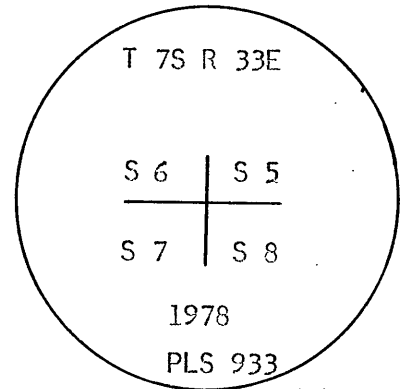

Office of County Surveyor County of Grant
 State of Oregon , I hereby verify that the within instrument was filed in this office
 for record on the 20 day of Sept, 1978
Robert D. Baggett by
 (COUNTY OFFICIAL) (DEPUTY)