


CORNER RESTORATION

CORNER: N1/4 SEC. 6 TWP. 8 S. RANGE 30 E.

ORIGINAL SURVEY BY: Frank Campbell

CONTRACT NUMBER: 380

CONTRACT DATE: March 19, 1881

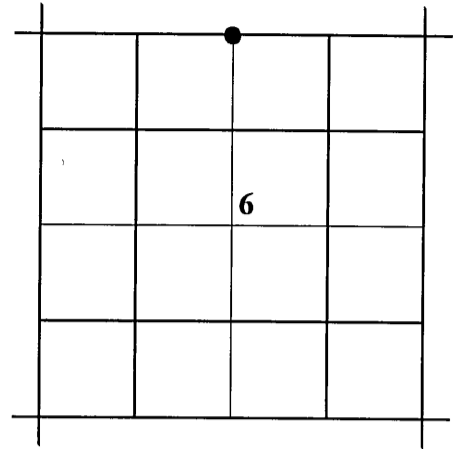

Subsequently remonumented by Duane Griffith in October, 1969, See Record Map of Survey No. 154

ORIGINAL DESCRIPTION: Set a basalt stone 12x8x6 in mound of stone for 1/4 sec. cor.

Survey No. 154 states: Found stone 12"x8"x6" mkd. 1/4, set in mound of stone. Replaced with 1-1/2" iron post with brass cap. From which: A 10" juniper bears S.15°E., 6.0 ft. mkd. 1/4 S6BT. A 14" juniper bears N.50°E., 116.2 ft. mkd. 1/4S31BT

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
D.E. Mooney

RECEIVED AND
FILED

MAY 7, 2001
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett

ATTEST: *M.L.C. Sp*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

Renewal Date 12/31/01

March 21, 2001

Grant County Surveyor

EVIDENCE FOUND: Found Griffith's 1½" galv. iron pipe with Grant County Surveyor brass cap projecting 28" out of ground, 2 ft. north of an east-west fence line. The attached brass cap is marked for the 1/4 cor. Also found a 21" dia. juniper tree N.53°E., 115.6 ft. to center. And a 12" dia. juniper tree S.20°E., 5.8 ft. to face of blaze. Blaze is almost completely healed, partial scribing visible.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings including compass var.

Griffith's galv. iron pipe and brass cap are firmly set and in good condition.

From which I SCRIBE NEW BEARING TREES:

A Juniper 23" diam., bears S.48°W., 93.6 ft. marked 1/4 S6 CSBT.

A Juniper 14" diam., bears N.51°W., 80.1 ft. marked 1/4 S31 CSBT.

Rebuilt mound of stone 3 ft. base to within 6" of top of cap. Used mag. compass with 18° var. and steel tape, measuring to a 50d nail driven in the side-center at the root crown of the new BT's. Attached BT tags to BT's.