


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established in 1884 by Herman Gradon:
 Set a post 4' long, 4" square, 24" in ground
 with 5 notches on East and 1 notch on West edges
 from which
 An 8" pine bears N 30° E., 46 lks. (30.3 ft.)
 An 8" pine bears N 77° W., 24 lks. (15.8 ft.)

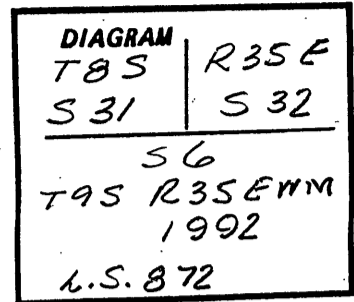

In 1981, D.M. Bartleson found N.E. dead B.T. with visible scribing and placed signs on it.

Description of corner evidence found:

No evidence of original corner post.
 Found 10" pine down in N.E. with visible scribing and signs.

Description of monument and accessories established to perpetuate the original location of this corner:

From original down B.T. in N.E. reset the corner: A 2" x 36" split-base pipe with 3" brass cap. No stones available. Brass cap is marked as shown in the above diagram.

NEW BEARING TREES:

A 14" fir bears N 46° W., 39.7 ft. Mkd. T8S, R35E, S31, BT
 An 8" fir bears N 64-3/4° E, 21.3 ft. Mkd. T8S, R35E, S32, BT
 A 6" pine bears S 2-1/2° W, 10.7 ft. Mkd. T9S, R35E, S6, BT
 A 6" pine bears S 42 1/2° E. 39.3 ft. Mkd. T9S, R35E, S6, BT 6/18/93
 All trees single blazed with 1" brass disk marked P.L.S. 872 nailed flush to "BT"

B.T. tags and 54.9 signs placed on all B.T.'s with 6" red band painted around each B.T. and blazes.

A steel fence post with 54.9 sign was placed by corner.



I hereby certify the above corner point was perpetuated as herein described on October 15, 1992.

Office of... *Surveyor* ... County of... *Grant* ...
 State of... *Oregon* ... I hereby certify that the within instrument was filed in this office
 for record on the... *26* day of... *July* ... 19... *93*
Robert D. Leggett by
 (COUNTY OFFICIAL) (DEPUTY)