

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

V-7 T 8 S R 36 E


History of original corner establishment:

Corner established by Otis O. Gould under special instructions dated Nov. 27, 1935, which provided for the surveys included under Group No. 179.

Surveyor General records state:

Set an iron post 3 ft long 1 in dia 10 ins in the ground to solid rock and in a mound of stone to top for 1/4 sec cor with brass cap marked (as shown in corner diagram) from which:

A fir 12 ins dia bears N60°W, 34 lks dist marked 1/4S29 BT.
A fir 6 ins dia bears S20°E, 29 lks dist marked 1/4S32 BT.

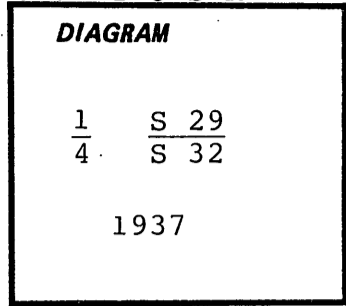

Description of corner evidence found:

Found a 2 1/2" brass cap on a 1" iron post protruding 12" from mound of stone marked as shown in corner diagram.

A fir 14 ins dia bears S19°E, 16.1 ft with healed blaze (record states: S20°E, 29 lks)

A fir 16 ins dia bears N53 1/2°W, 26.8 ft with partially healed blaze and visible scribes (record states: N60°W, 34 lks)

Description of monument and accessories established to perpetuate the original location of this corner:

Corner monument maintained to USFS standards as follows...cleared brush and debris from around cor monument and made rock mound. Placed 6' steel fence post W of cor with sign 54-9 attached.

Each original bearing tree has signs 54-3 and 54-9 attached below a 6 inch band of red paint.

Compass declination 19° East.

I hereby certify that the above corner monument was properly maintained to U.S.F.S. standards under my supervision and witnessed by Willard Hulick on August 2, 1986.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Willard R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of.....County Surveyor..... County of...Grant.....
State of.....Oregon....., I hereby certify that the within instrument was filed in this office
for record on the...8... day of...Sept....., 19...86
Robert A. Dager by
(COUNTY OFFICIAL) (DEPUTY)