

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

None previously established.
See Record Map of Survey No. 2026

R.5-21

DIAGRAM


N-N
1/64
S26 | S25
PLS 2645
2014

Description of corner evidence found:

Not Applicable

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 3" x 30" aluminum pipe with a 3 1/4" aluminum cap marked as shown in a collar of stone. A magnet in a clear plastic case was deposited at the base of pipe. Cap is 2 1/2" above the collar of stone.

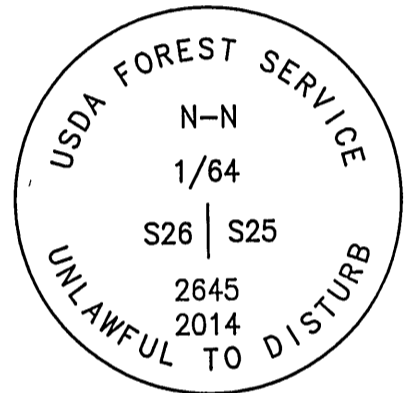

New accessories:

A 19" Ponderosa Pine scribed "1/64 S26 BT" with a aluminum tag marked "2645" bears N16°W 36.25'.
A 13" Ponderosa Pine scribed "1/64 S26 BT" with a aluminum tag marked "2645" bears S81°W, 70.7'.

Note:

Corner falls 7' south of Forest Service Road #140.

Geodetic Coordinates (NAD83):

N 44°51'02.3"

W 119°34'24.6"

Geodetic coordinates were obtained from a Garmin recreational grade GPS receiver.

Date: July 24, 2014

Declination: 17° E

Witnesses: Torricio Quiniones, Paul Guglielmelli and Robert Flora

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JANUARY 18, 1994
MARK A. LICHTENTHALER
2645

EXPIRES 12-31-2018