

CORNER RESTORATION

T. 9 S., R. 26 E., W.M.


CORNER: SECTION CORNER COMMON TO SECS. 8, 9, 16 & 17

ORIGINAL SURVEY BY: AARON F. YORK

CONTRACT NUMBER: 335

CONTRACT DATE: AUG. 11, 1879

COMPLETION DATE: NOV. 24, 1879

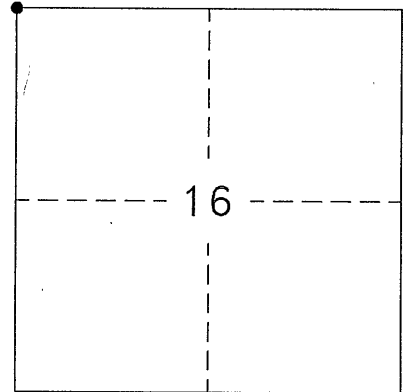

ORIGINAL DESCRIPTION: "SET STONE 18x12x4 FOR COR. TO SECS. 8, 9, 16 & 17. STONE MOUND AT COR."

RESTORATION BY,
STAMP AND DATE:

JACK E. RANDELL JR.
MON. SET: 10/2/04

WITNESS POINTS SET: 3/17/07

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 13, 2004
JACK E. RANDELL
74807

RENEWAL DATE: 12/31/08

RECEIVED AND
FILED

MAR 29, 2007
OFFICE OF COUNTY SURVEYOR
Attest: *[Signature]*

EVIDENCE FOUND:

FOUND SMALL, EMBEDDED MOUND OF STONE WITH A 12x8x20" STONE LYING ALONGSIDE. (NO MARKINGS DISCERNIBLE) ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE ORIGINAL CORNER LOCATION.


DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

SECTION CORNER LOCATION WAS RESTORED FROM FOUND EVIDENCE OF THE ORIGINAL CORNER LOCATION. (REF: RECORD MAP OF SURVEY NO. 1726).

THE 1/4 SECTION CORNER COMMON TO SECTIONS 9 & 16, BEARS S89°09'51"E A DISTANCE OF 2559.51 FT., AND THE 1/4 SECTION CORNER COMMON TO SECTIONS 16, 17 BEARS S02°15'44"E, A DISTANCE OF 2465.63 FT.

AT THE SECTION CORNER LOCATION, I SET A 5/8x30" REBAR WITH 2" ALUMINUM CAP IN THE CENTER OF THE FOUND REMAINS OF MOUND, REPLACED THE FOUND STONE, AND RE-BUILT THE MOUND. I SET A 5 FT. "U-BAR" FENCE POST AS GUARD STAKE.

MONUMENT MARKED:

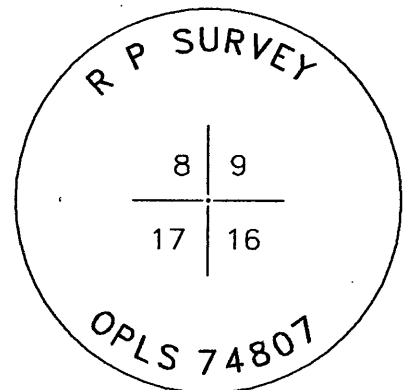

AT THE DIRECTION OF ROBERT D. BAGETT, GRANT COUNTY SURVEYOR, I ALSO SET FOUR (4) WITNESS POINTS TO THE SUBJECT CORNER, CONSISTING OF 5/8"Ø REBARS WITH 2" ALUMINUM CAPS STAMPED "RP SURVEY, OPLS 74807, WP". THE DIRECTIONS FROM THE SUBJECT CORNER TO THE WITNESS POINTS WERE DETERMINED WITH A MAGNETIC COMPASS USING AN 18° EAST VAR. THE COURSES FROM THE SUBJECT CORNER TO THE WITNESS POINTS ARE AS FOLLOWS:

- NO. 1: N. AZ. 5° 24.20 FT. (HORIZ.)
- NO. 2: N. AZ. 60° 28.70 FT.
- NO. 3: N. AZ. 164° 20.42 FT.
- NO. 4: N. AZ. 221° 30.46 FT.