


## CORNER RESTORATION

CORNER NE CC  
sec 5 TWP 9S RANGE 27E WM

ORIGINAL SURVEY BY: Aaron S York

CONTRACT NUMBER: 335

CONTRACT DATE: August 11, 1879

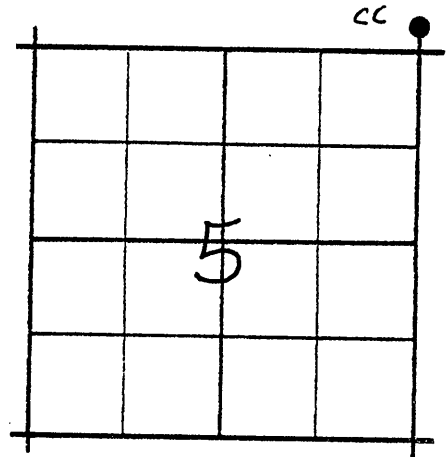


**ORIGINAL DESCRIPTION:**

N. bet secs. 4 and 5 on true line.  
 76.80 chs. Intersected Special Standard 96 lks. E. of cor to secs 33 & 34,  
 T8S R27E.  
 Set stone 16x16x12 for closing cor. to secs. 4 and 5  
 T9S R27E.  
 Stone mound at cor.

**RESTORATION BY, STAMP AND DATE:**

BAGETT, GRIFFITH & FERGUSON  
 170 S. DAYTON - PH. 575-1251  
 JOHN DAY, OREGON 97845

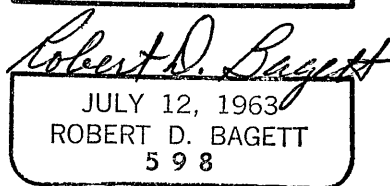

Jan. 1971

**EVIDENCE FOUND:**

Found basalt stone 16x16x12 mkd CC with four grooves in face and set in a mound of stone, 31 feet N. of the Twp line. The falling to the standard cor. to secs 33 & 34 is about 545 feet instead of 96 lks E as called for in the gov't. field notes. This position fits improvements in sec. 5 and is harmoniously related to other corners found in the area.

**DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:**

Show how trees are scribed and basis of bearings, including compass var.  
 Set a 1 1/2 x 3/8 inch iron pipe 12 ins. in the ground, with brass cap mkd as shown. from which

A 10" juniper bears S53°W, 136.5 ft, mkd. T9S R27E S5 CC BT

A 16" juniper bears N62°W, 177.0 ft, mkd. X BT.

No BTs available in SE quadrant.

Raise a mound of stone 4 ft. base to top of pipe  
 Set orig. cor. stone S. & alongside pipe.

Complete and File with Office of the Grant  
 County Surveyor, Grant County, Oregon, Compass brngs. Var. 20° E  
 Courthouse, Canyon City, Oregon 97820 steel tape

