

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established by: Aaron York, Deputy Surveyor, under Contract No. 309, dated November 18, 1878.


Surveyor General Record States: Intersected special standard line 88 lks East of standard corner to T8S, R27&28E, W.M. Set stone 16x12x8, for closing corner to Sections 1&2 raised Mound of stone at corner.

ODOT Highway Drawing No. 6B-20-5 calls a found mound of stone at the closing corner. I used the highway tie and found the mound of stone. No marked stone was found.



Description of corner evidence found:

I accept the mound of stone as the best available evidence of the corner position.

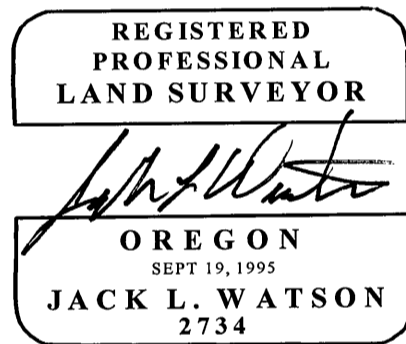

Renewal Date 6/30/2022

Description of monument and accessories set at corner location:

At the center of the stone mound I set a 5/8"x30" iron pin with attached 2" aluminum cap. The cap is stamped as shown in the diagram.

From which:

- A 5" Juniper bears S51°E, 14.92 feet, marked XBT
- A 6" Juniper bears S82°E, 36.19 feet, marked XBT
- A 5/8"x30" iron pin with attached red plastic cap bears S17°W, 16.20 feet
- A 5/8"x30" iron pin with attached red plastic cap bears S17°W, 26.58 feet

I used GPS to measure to the references, the bearings are based on Grant County Survey No. 2154

Date: April 20, 2021

Prepared by: Jack Watson
233 S. Canyon Blvd
John Day, OR 97845

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

APR 23 2021

BY: *[Signature]*

A21