

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established by: Aaron York, Deputy Surveyor, under Contract No. 335, dated August 11, 1879.



Surveyor General Record States: Set stone 18x9x7 inches for 1/4 corner raised stone mound at corner.

This corner was found by W.F. White in 1895, see Survey Record Book A, Page 19. Mr. White's record: From the C1/4 corner of Section 1: "I then run West to the 1/4 section corner on the west line and find the distance to be 43.00 chains.



Description of corner evidence found:

Found mound of stones, no stone of call size was found. I accept the stone mound for the best available evidence of the corner position. I found the mound to be S89°36'49"W, 2838.54 feet from the C1/4 corner. This corner falls on a very steep hillside with many loose rocks, which may explain the missing corner stone.

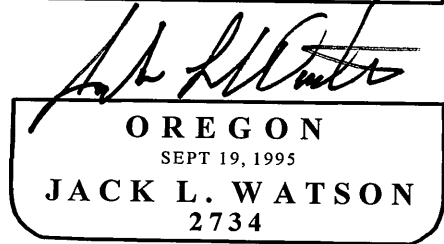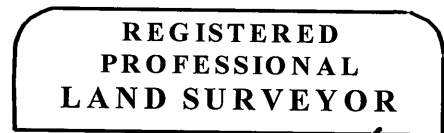

Renewal Date 6/30/2022

Description of monument and accessories set at corner location:

I accept the center of the mound of stone for the corner position. I set a 5/8"x30" iron pin with attached 2" aluminum cap, surrounded by a mound of stone to support the monument. The cap is stamped as shown in the diagram.

From which:

- A 5/8"x30" iron pin with attached red plastic cap bears N18°E, 15.25 feet
- A 5/8"x30" iron pin with attached red plastic cap bears N77°E, 11.56 feet
- A 5/8"x30" iron pin with attached red plastic cap bears S38°W, 7.25 feet
- A 5/8"x30" iron pin with attached red plastic cap bears N38°W, 7.96 feet

I used RTK GPS to measure to the references. The bearings are based on Grant County Survey No.2154.

Date: April 20, 2021

Prepared by: Jack Watson
233 S. Canyon Blvd
John Day, OR 97845

**RECEIVED AND FILED
GRANT COUNTY SURVEYOR**

APR 23 2021

BY: 

C21