


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner was established by Rufus S. Moore, US Deputy Surveyor, during the original survey Contract No. 382 dated March, 1881.  
 Set a tamarack post for corner to secs. 4, 5, 32, 33 from which a  
 Pine 14 ins. diam., bears N42°E, (19.14') 29 lks. dist.  
 Pine 6 ins. diam., bears N25°W, (11.89') 18 lks. dist.  
 Pine 30 ins. diam., bears S64°W, (52.14') 79 lks. dist.  
 Pine 12 ins. diam., bears S18°E, (36.30') 55 lks. dist.

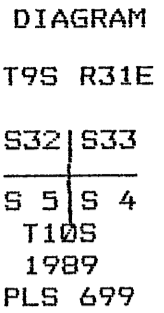

Description of corner evidence found:

There was no evidence of the original corner post. The corner position based on the two found BT's was beside the fence corner.  
 24" Ponderosa pine (34" Stump)(Scribing Visible)(1881 BT) bears S67°45'W, 51.9 feet.  
 Ponderosa pine (Down & Rotting Away)(Scribing Visible)(1881 BT) bears at record.  
 14" Pine (1881 BT) not found. 6" Pine (1881 BT) not found.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 2"x30" aluminum pipe with a 2 1/2" aluminum cap, marked as shown in the diagram, 24" in the ground, at the point determined by the bearing trees. Built a mound of rock & earth to be 36" in diameter by 6" high around the monument, from which new BTs are:  
 3" Juniper bears S49°W, 15.8 feet scribed T10SR31E S5 BT  
 4" Ponderosa pine bears N70°W, 13.2 feet scribed T9SR31E S32 BT  
 12" Juniper bears N17°30'E, 37.1 feet scribed T9SR31E S33 BT  
 5" Juniper bears S66°E, 46.9 feet scribed T10SR31E S4 BT

Attached BT and Attention signs to and painted a red band around each BT. Bearings were turned from the control traverse with a theodolite, basis of bearing being the bearing between corners G-13 and N-13 as shown on Grant County Map of Survey No. 634, to stamped brass washers nailed in the scribed red-painted blazes. Distances were measured from a 60d spike, with an aluminum washer stamped PLS 699, which was driven into the side of each BT approximately one foot above the ground.  
 Set steel fence posts 5 feet S and 5 feet E of the corner on the National Forest boundary lines. Attached Forest Boundary signs to each post and an Attention sign to the S post.

I, Leland L. Myers, P.O. Box 98, Sumpter, OR 97877, do hereby certify that on September 5/, 1989, I monumented the corner as herein described.

FILED

IN THE OFFICE OF THE Grant COUNTY SURVEYOR  
 THIS 26 DAY OF July, 1990

Robert D. Baggett  
 Grant County Surveyor

REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

*Leland L. Myers*

OREGON  
 JULY 9, 1965  
 LELAND LEE MYERS  
 699