

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner was established by Herman D. Gradon, US Deputy Surveyor, during the original survey Contract No. 416 dated August, 1881.

Set a post 4 ins square & 4 ft long 24 ins in the ground for Cor. to Sec's 24, 25, 19 & 30 marked T9S S19 on NE, R33E S30 on SE, R32E S25 on SW, and S24 on NW faces with 2 notches on S. and 4 notches on N. edges from which

- A pine 40 ins diam bears N73°E, (40.3')61 lks dist marked T9SR33E S19 BT
- A fir 16 ins diam bears S42°E, (18.5')28 lks dist marked T9SR33E S30 BT
- A fir 40 ins diam bears S85°W, (13.9')21 lks dist marked T9SR32E S25 BT
- A tamarack 15 ins diam bears N43°W, (36.3')55 lks dist marked T9SR32E S24 BT

DIAGRAM

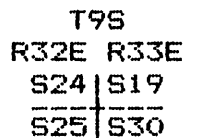

1986
PLS 699

Description of corner evidence found:

Corner location fall in an old skid trail and no evidence of the original post was found.

- 36" Ponderosa pine (20" Stump)(Scribing Visible)(1881 BT) bears N73°E, 40.8 feet.
- 24" Douglas-fir (16" Stump)(Scribing Visible)(1881 BT) bears N39° 30'E, 19.4 feet.
- 22" Western larch (Fair Condition)(Scribing Visible)(1881 BT) bears N40° 15'W, 36.4 feet.
- 40" fir (1881 BT) not found.

Description of monument and accessories I established to perpetuate the original location of this corner:


Set a 2"x30" aluminum pipe with a 3 1/4" aluminum cap, marked as shown in the diagram, 26" in the ground, at the point determined by the bearing trees. Built a mound of earth to be 24" in diameter by 4" high around the monument, from which new BTs are:

- 6" Western larch bears N50°E, 29.4 feet scribed T9SR33E S19 BT
- 17" White fir bears S65° 15'E, 41.2 feet scribed T9SR33E S30 BT
- 11" White fir bears S82° 30'W, 55.0 feet scribed T9SR32E S25 BT

Attached BT and Attention signs to and painted a red band around each BT. Bearings were taken with a staff compass, using a declination of 18° 30'E, to stamped brass washers nailed in the scribed red-painted blazes. Distances were measured from a 60d spike, with an aluminum washer stamped PLS 699, which was driven into the side of each BT approximately one foot above the ground.

Set a steel fence post 5 feet S of the corner with an Attention sign attached. The monument is not a National Forest property corner.

I, Leland L. Myers, P.O. Box 98, Sumpter, OR 97877, do hereby certify that on July 26, 1986, I monumented the corner as herein described.

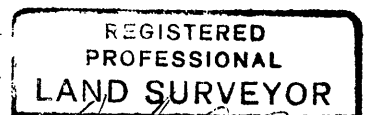

FILED

IN THE OFFICE OF THE Grant COUNTY SURVEYOR
THIS 23 DAY OF Feb, 1987

Robert D. Sayth
Grant County Surveyor

