

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner was established by Herman D. Gradon, US Deputy Surveyor, during the original survey Joint Contract No. 383 dated March, 1881.

Set stone 14x10x10 for Cor. to Sec's 5, 6, 31 & 32 from which

- A fir 15 ins diam bears N30°W, (62.0') 194 lks dist
- A pine 36 ins diam bears N47°E, (72.6') 110 lks dist
- A pine 18 ins diam bears S40°E, (63.4') 96 lks dist
- A pine 20 ins diam bears S22°W, (21.8') 33 lks dist

DIAGRAM

T9S R33E

S31	S32
S 6	S 5
T10S	
1986	
PLS 699	

Description of corner evidence found:

15x10x10 stone with 5 notches E and 1 notch W in a mound of stone.

- 15" Douglas-fir (Down & Rotting Away) (1881 BT) bears at record. No evidence of the blaze & scribing could be found.
- 33" Ponderosa pine (Dead) (Scribing Visible) (1881 BT) bears N53° 30'E, 73.8 feet.
- 28" Ponderosa pine (Good Condition) (Blaze Opened by Others) (1881 BT) bears S34° 30'E, 62.6 feet.
- 36" Ponderosa pine (Fair Condition) (Scribing Visible) (1881 BT) bears S26°W, 21.5 feet.

Description of monument and accessories I established to perpetuate the original location of this corner:


Set a 2"x30" aluminum pipe with a 3 1/4" aluminum cap, marked as shown in the diagram, 16" in the ground to rock, replacing the rock which is turned upside down and buried on the north side of the monument. Improved the existing mound with rock & earth to be 36" in diameter by 12" high around the monument, from which new BTs are:

- 21" Douglas-fir bears N1° 30'E, 30.5 feet scribed T9SR33E S31 BT
- 9" Douglas-fir bears N69° 30'E, 40.9 feet scribed T9SR33E S32 BT

Attached BT and Attention signs to and painted a red band around each BT. Bearings were taken with a staff compass, using a declination of 18° 30'E, to stamped brass washers nailed in the scribed red-painted blazes. Distances were measured from a 60d spike, with an aluminum washer stamped PLS 699, which was driven into the side of each BT approximately one foot above the ground.

Set a steel fence post 5 feet W of the corner with an Attention sign attached. The monument is not a National Forest property corner.

I, Leland L. Myers, P.O. Box 98, Sumpter, OR 97877, do hereby certify that on August 31, 1986, I monumented the corner as herein described.

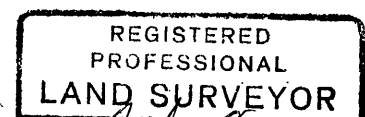

FILED

IN THE OFFICE OF THE Grant COUNTY SURVEYOR

THIS 23 DAY OF Feb, 1987

Robert H. Bayett
Grant County Surveyor

