


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original Survey by Eugene P. McCornack under contract No. 398 dated July 2 1881

Set Basalt stone 12x9x7 ins 8 ins in the ground for 1/4 sec. cor. marked 1/4 on W face. All the surrounding timber dead I raised a mound of stone along side.

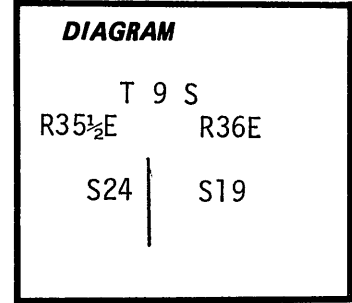

Description of corner evidence found:

At the corner location I found a 12"x9"x7" stone marked 1/4 on W face at the S end of a mound of stone

Description of monument and accessories I established to perpetuate the original location of this corner:


I replaced the original stone with a 2 1/2"x32" aluminum capped aluminum pipe set 26" in the ground in a mound of stone from which
 A 16" Lodgepole pine bears S54° E 46.50 ft marked 1/4 S 19 BT nail in NE base
 An 11" Ponderosa Pine bears N18° W 72.18 ft marked 1/4 S 24 BT nail in E base.

Bearings taken with a staff compass declination 18 1/2° East per 1980 Isogonic chart.

Distances pulled to 60d nail with Brass washer stamped LS 1898 driven in the side center of the bearing tree.

I hereby certify that the above monument was re-established as herein described on August 3, 1983

MONUMENT STAMPED

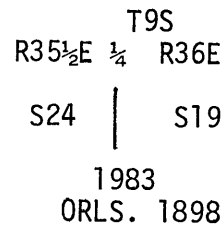

8 August 1983

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Harry C. Hildebrand

OREGON
JULY 18, 1980
HARRY C. HILDEBRAND
1898

Office of.....Surveyor..... County of.....Grant.....
 State of Oregon, I hereby certify that the within instrument was filed in this office
 for record on the 16 day of Sept, 1983
Robert D. Bayett by _____
 (COUNTY OFFICIAL) (DEPUTY)